


CAUTION

Turn off the main power at the circuit breaker before installing the fixture in order to prevent possible shock. If you are unfamiliar with proper electrical wiring connections, obtain the services of a qualified electrician.

GENERAL

Read all instructions carefully for safe operation and installation. All electrical connections must be in accordance with local and national electrical code (N.E.C.) standards. Remove the fixture and mounting package from the box. Make sure no parts are missing by referencing the illustrations on these Installation Instructions. Please contact Blackjack Lighting at 847-941-0588 if any parts are missing or damaged. This product is suitable for DAMP locations.


JACKTRACK PENDANT ADAPTER EXPLODED VIEW

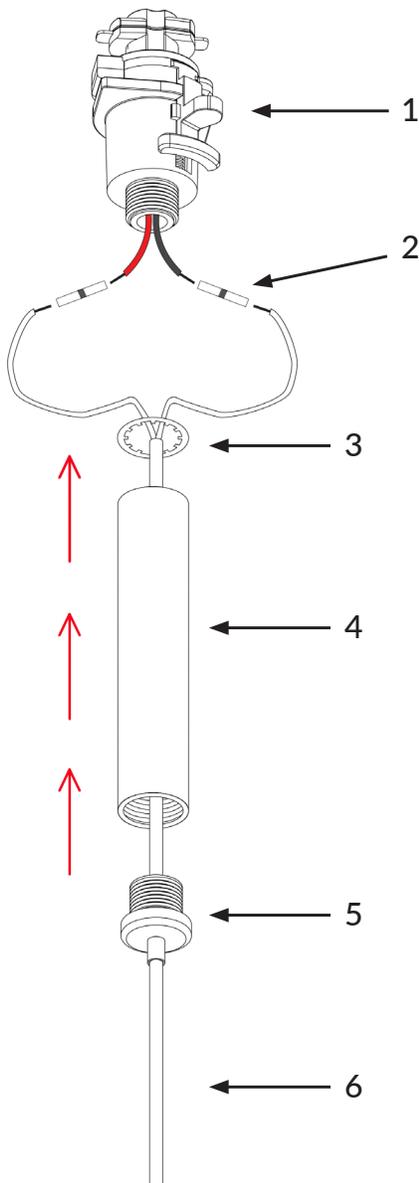

- 1. SPRING-LOADED LEVER
- 2. SOLDER STICKS
- 3. TOOTHED WASHER
- 4. STEM BODY
- 5. ADJUSTABLE CABLE GRIPPER
- 6. CABLE

- PARTS BAG INCLUDES:**
- THESE INSTRUCTIONS
 - TWO (2) SOLDER STICK WIRE CONNECTORS
 - ONE (1) PIECE BLACK HEAT SHRINK TUBING


1. DETERMINE REQUIRED CABLE LENGTH

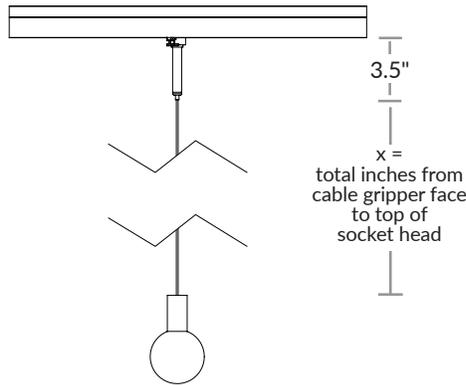

A. Determine overall length of cable from the cable gripper face to top of socket head (x"). Measure and place gripper in this position.

NOTE: Cable gripper face sits 3.5" below bottom of channel track.

2. CUT AND STRIP CABLE END

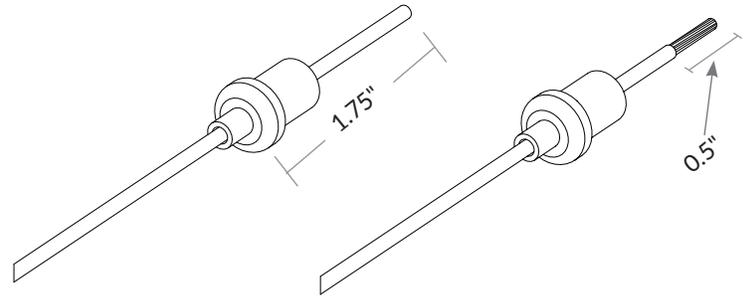

A. Cut cable end 1.75" above face of gripper.


B. Strip off outer insulation 0.5" from end.

NOTE: Cable cannot be adjusted after cutting.

3. INSERT CABLE INTO TRACK ADAPTER



A. Unscrew stem from adapter.

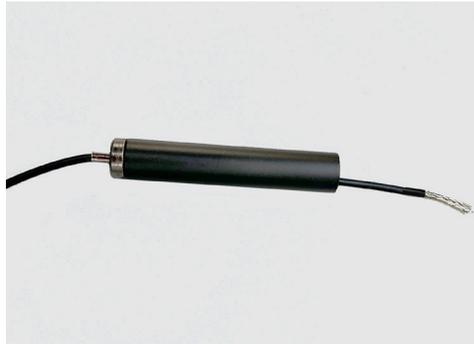


B1. Pull cable end out from gripper and thread gripper into stem.

B2. Re-attach gripper to stem.




C1. Twist exposed braided wire into a bundle.

C2. Strip off inner insulation (approx. 3/4").

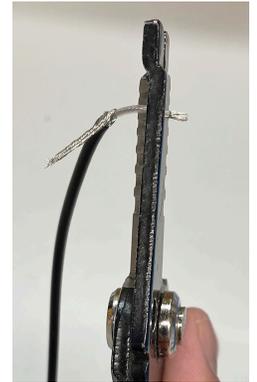


D1. Replace toothed washer on cable.

D2. Insert heat shrink tube onto cable to be used in Step K.

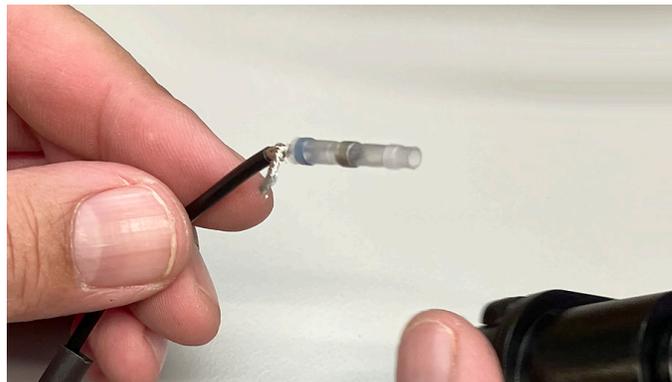


E. Insert middle stripped wire into solder stick. Make sure exposed wire is inside center solder ring.

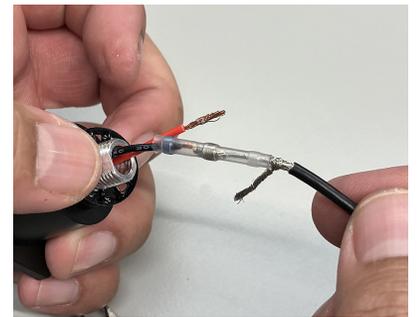

F. Insert red cable from track adapter into solder stick. Make sure exposed wire is inside center solder ring.




G. Heat up solder stick with heat gun. Temperature must reach at least 285°F to thoroughly melt solder ring.

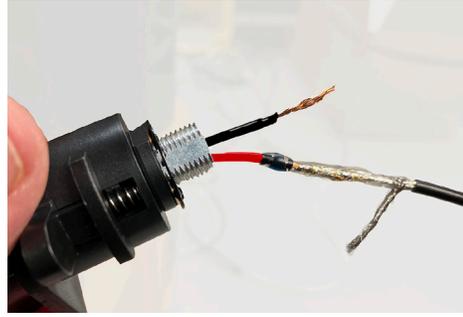


H. Soldering is successful when the solder ring melts and evenly coats the exposed wire ends.

EXAMPLE:

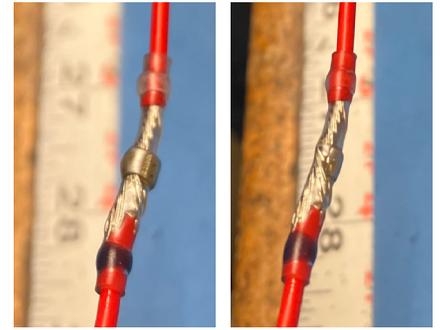

**NOT MELTED
PROPERLY**

**MELTED
PROPERLY**

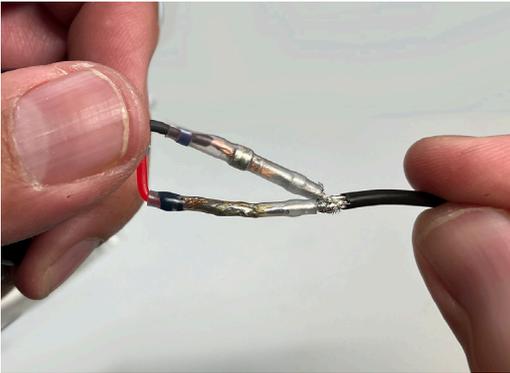

I. Insert black cable from track adapter into second solder stick. Insert twisted braided wire bundle from cable into the other side.



J. Repeat Steps G & H.



K. Place black heat shrink tubing over both solder sticks and shrink with heat gun.



L. Depress collar on gripper and adjust cable through gripper to desired cable length (see Step 1).



M. Screw the stem (with toothed washer) back over threaded end of track adapter.



N. Attach pendant adapter to track to test wire connection. *See following pages for details.*




TO ATTACH TRACK ADAPTER






Scan this QR code to view Blackjack's animated JackTrack Adapter Installation Instructions.

1. Position pendant adapter in desired location along track.

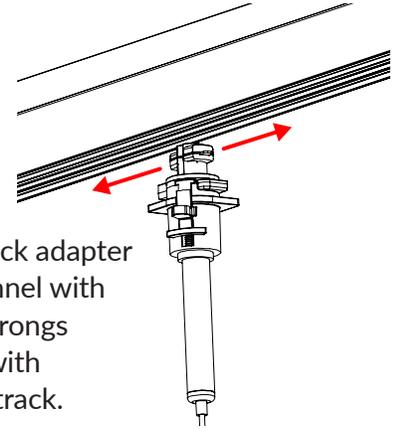

2. Push track adapter into channel with copper prongs aligned with channel track.

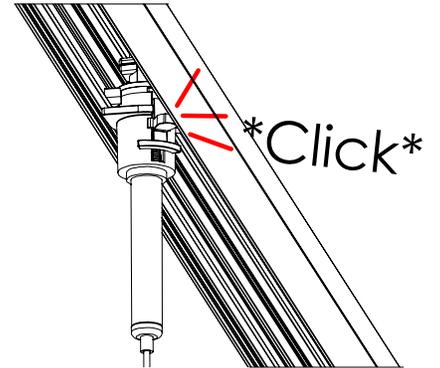
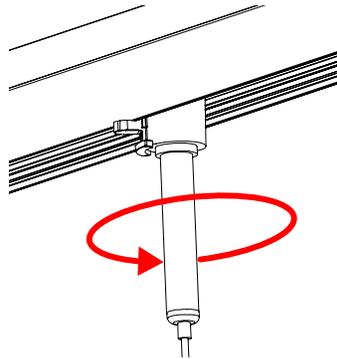
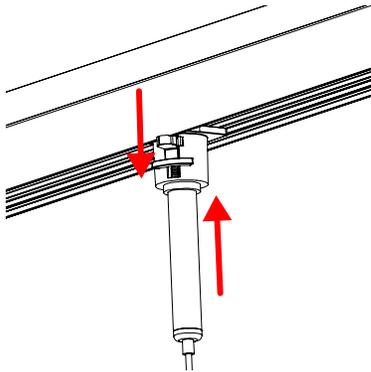


3. Push up so that the spring lever is compressed and turn counter clock-wise 90 degrees. *Note: If it locks up when turning take adapter out and try it with adapter facing the other direction.*

4. Turn until spring lever falls into track and adapter "clicks" into place. This secures the adapter.

NOTE: Adapter may be removed and repositioned as needed along track.

TO REMOVE TRACK ADAPTER

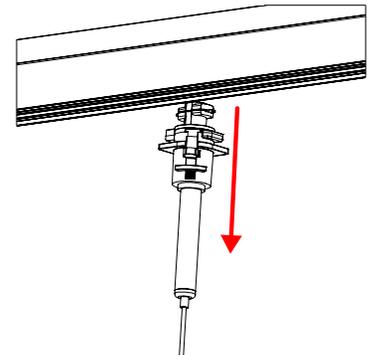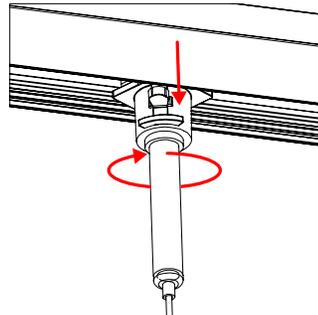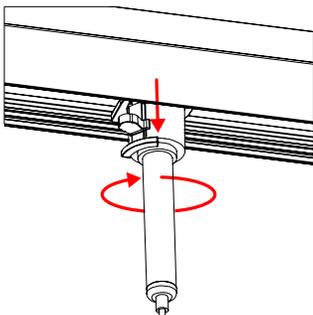

1. Pull spring lever down so it clears the track and rotate adapter clockwise 90 degrees.

2. Gently pull down to remove adapter.